

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2012

Published October 12, 2012

CHILD SEATS:

Certain Evenflo Big Kid Factory Select booster seats, Model Nos. 30911173AD, 3091967AD, 30911118AD, and 30911120D, shipped between August 6, 2012, and September 18, 2012, fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 213, "Child Restraint Systems." The subject seats were originally manufactured solely for purposes of retail display and not to be sold at retail. Therefore, the seats were packaged without the instruction manual or the required registration card. However, the seats were inadvertently shipped to Evenflo's institutional customers (i.e. hospitals, government agencies) to be given to families. None of the affected units were sold at retail stores. Without the instruction manual the seat may be used improperly. Should the owner not file a registration with the child seat manufacturer due to lack of information on how to do so, they may not be notified of a safety recall. Either condition puts the child at an increased risk of possible injury in the event of a crash. The affected seats have a label stating: "DISPLAY ONLY - NOT INTENDED FOR SALE," located on the back of the booster seat headrest. Evenflo will mail owners who have received an affected Big Kid booster seat a remedy kit that includes a consumer registration card, an instruction manual, and an overlabel to cover the current label stating: "DISPLAY ONLY - NOT INTENDED FOR SALE." The remedy kit will be provided free of charge. Notification began on October 10, 2012. Owners may contact Evenflo at 1-800-233-5921 or at safety.evenflo.com.

12C-003

EQUIPMENT:

EV-Charge America Ltd. (EVCA) is recalling certain electric vehicle charging stations produced from May 15, 2009, through August 15, 2012. Due to an improper relay, the electrical lead that connects to the vehicle may be energized even when the charging station is turned off. A user could suffer an electrical shock should they contact the electrical lead. This risk may exist even when the charging station is turned off. EV-Charge America will notify owners and the units can be returned for repair or an EVCA technician will repair the unit(s) onsite, free of charge. Owners may contact EVCA at 1-702-278-8005.

12E-033

Automotive Innovations, Inc. (AII) is recalling certain Electronic Gas/Brake (EGB) systems, produced from January 1, 2000, through July 11, 2012, installed as adaptive equipment on motor vehicles. The equipment was produced without an adequate back-up brake diagnostic system. As such, it may be possible for the driver to operate the vehicle without knowing the back-up brake is malfunctioning. Without the driver being alerted that the back-up brake system has malfunctioned, the driver may continue to operate the vehicle as normal, and if the primary brake system system also fails, braking performance would be reduced increasing the risk of a crash. AII will notify owners and repair the vehicles free of charge. The manufacturer has not yet provided the agency with a notification schedule. Owners may contact AII at 1-508-697-6006.

12E-034

TIRES:

None during September 2012.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2012

Published October 12, 2012

VEHICLES:

WMK Inc., d/b/a MobilityWorks, is recalling certain model year 2006-2010 Ford E-Series vehicles equipped with Century-2 and/or Vista-2 wheelchair lifts. Over time and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned. A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury. MobilityWorks will notify owners, and the repairs will be performed by authorized Braun dealers free of charge. The safety recall is expected to begin on, or about, October 16, 2012. Owners may contact MobilityWorks at 1-800-769-8267.

12V-427

Forest River, Inc.(Forest River) is recalling two model year 2009 Rockport commercial vehicles, manufactured from April 27, 2009, through May 29, 2009, equipped with Sure Power battery separator devices, due to overheating. Overheating of the battery separator can result in smoke and possible fire. Forest River has notified the owners and arranged to replace the battery separators free of charge. Owners may contact Forest River at 1-574-295-8749.

12V-428

Spartan is recalling certain model year 2008-2013 K2 and MM motor home chassis, equipped with a Hendrickson independent front suspension. The front brake chambers may contact the upper control arm of the independent front suspension. Continued contact may result in damage sufficient enough to inhibit the full release of the brakes. If the brakes do not fully release, as they drag, heat could be generated causing the brakes to engage even further. As the brakes self-engage, the driver could lose control of the vehicle, increasing the risk of a crash. Spartan chassis will notify owners, and repair the vehicles free of charge. The safety recall is expected to begin during October 2012. Owners may contact Spartan at 1-800-543-5008. Spartan's safety recall number is 12010.

12V-429

Lamborghini is recalling certain model year 2004-2006 Gallardo Coupe and Spyder vehicles. In certain driving conditions, the high pressure steering pipes near the the steering assistance hydraulic system pump might leak. Leaking fluid, in the presence of an ignition source, could result in a fire. Lamborghini will notify owners, and dealers will update the power steering system free of charge. The safety recall began on September 26, 2012. Owners may contact Lamborghini at 1-703-364-7042.

12V-430

Ford is recalling certain model year 2013 Escape vehicles manufactured from October 5, 2011, through August 31, 2012, equipped with 1.6L engines. The cylinder head cup plug (freeze plug) may become dislodged resulting in significant loss of engine coolant. As leaking engine coolant evaporates on the hot engine, the glycol may ignite causing an engine compartment fire. Ford will notify owners, and dealers will seal the existing plug and add a secondary plug cover, free of charge. The safety recall began on September 11, 2012. Owners may contact Ford at 1-866-436-7332. Ford's recall campaign number is 12S39.

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2012

Published October 12, 2012

12V-431

Honda is recalling certain model year 2012 Ridgeline vehicles manufactured on April 18, 2012. An incorrect passenger airbag status indicator may have been installed on the vehicles causing them to fail to conform to the requirements of Federal Motor Vehicle Safety Standard No. 208, "Occupant Crash Protection." Without the proper passenger airbag indicator, the driver and other vehicle occupants may not be informed or aware that the front passenger airbag is off and will not deploy in a crash, thereby potentially increasing the risk of injury to a front passenger seat occupant that may have chosen to sit or been seated elsewhere in the vehicle if the correct indicator had been given. Honda will notify owners, and dealers will replace the passenger airbag indicator free of charge. The safety recall began on September 21, 2012. Owners may contact Honda Automobile Customer services at 1-800-999-1009. Honda's recall campaign number is S52.

12V-432

Mack is recalling certain model year 2007-2010 CHU and CXU vehicles, manufactured from October 13, 2006, through December 23, 2009 and equipped with daytime running lights and fog lights. A short in the fog light circuit may cause the low beam headlight circuit to cut out. If the low beam headlights go out, the driver may lose visibility, increasing the risk of a crash. Mack will notify owners, and install an additional wiring harness on the affected vehicles, free of charge. The safety recall is expected to begin on, or before, November 15, 2012. Owners may contact Mack Trucks at 1-800-866-1177. Mack's recall number is SC0365.

12V-434

Prevost is recalling certain model year 2013 X3-45 and MTH XLII-45E vehicles, all equipped with Volvo D13 engines and an automatic fire detection and suppression system (AFSS). The AFSS linear thermal detector wire may come in contact with or chafe against its supporting tie cables. If the detector wire chafes it may cause the AFSS to activate with no fire present and, as a result, the stop engine feature will be activated, bringing the vehicle to an unplanned stop and increasing the risk of a crash. Prevost will notify owners, and dealers will add a protection cloth to the linear thermal detector wire at the location of tie cable, free of charge. The safety recall began on September 27, 2012. Owners may contact Prevost Car Inc., Service Department toll-free at 1-866-870-2046 or 1-418-831-2046. The Prevost recall campaign number is SR12-29.

12V-435

Honda is recalling certain model year 2007 through 2011 Element passenger vehicles equipped with an accessory trailer hitch wiring harness. The wire that supplies power to the trailer turn signal lights was inadvertently switched with the stop lamp wire. As a result the turn signals only illuminate when the brake lamps are illuminated. This does not comply with the requirements of Federal Motor Vehicle Safety Standard No. 108, "Lamps, Reflective Devices, and Associated Equipment." Without trailer turn signal illumination, the driver's intent is not communicated, potentially increasing the risk of a crash. Honda will notify owners, and dealers will repair the vehicles free of charge. The safety recall began on September 20, 2012. Owners may contact Honda at 1-800-999-1009. Honda's recall campaign number is S53.

12V-436

National Van Builders, Inc., (National Van Builders) is recalling certain model year 2006-2011 Ford E-150, E-

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2012

Published October 12, 2012

250, and E-350 vehicles equipped with Braun Century-2 and/or Vista-2 wheelchair lifts. Over time and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned. A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury. National Van Builders will notify owners during October 2012, and the repairs will be performed by authorized Braun dealers free of charge. Owners may contact National Van Builders, Inc., at 1-508-222-2272.

12V-437

Ford is recalling certain 2012 Edge vehicles manufactured from September 2, 2010, through October 31, 2011, equipped with 2.0L engines. The fuel line pulse damper metal housing may crack as a result of an improper manufacturing process. A cracked fuel line pulse damper housing may result in a combination of fuel odor, weepage, or a continuous leak while the fuel system is pressurized. A fuel leak in the presence of an ignition source may result in a fire. Ford will notify owners, and dealers will repair the vehicles free of charge. The safety recall began on September 27, 2012. Owners may contact Ford Motor Company Customer Relationship Center at 1-866-436-7332. Ford's recall campaign number is 12S40.

12V-438

Volvo is recalling certain model year 2013 S60 and XC60 vehicles. A manufacturing defect within the Supplemental Restraint System (SRS) control unit may lead to an inadvertent deployment of the seat belt pretensioner and/or inflatable curtain. If the seat belt pretensioner and/or inflatable side curtain deploy without cause, the driver could be distracted and the driver's visibility could be reduced, increasing the risk of a crash. These vehicles have not been sold and the SRS control unit will be replaced prior to the cars being sold. Owners may contact Volvo at 1-800-458-1552. The Volvo recall campaign number is 257.

12V-439

New England Wheels, Inc., (New England Wheels) is recalling certain model year 2006-2010 Ford E-150, E-250, and E-350 vehicles equipped with Braun Century-2 and/or Vista-2 wheelchair lifts. Over time and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned. A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury. New England notified owners during September 2012. The repairs will be performed by authorized Braun dealers free of charge. Owners may contact New England Wheels, Inc., at 1-978-663-9724.

12V-440

Utilimaster is recalling certain model year 2012 Reach vehicles manufactured from October 1, 2011, through August 28, 2012. The adhesive used to attach the floor mat to the floor in front of the driver's seat may deteriorate allowing the floor mat to separate from the floor. An unsecured floor mat could interfere with the throttle pedal. Floor mat interference with the throttle pedal could prevent the throttle pedal from retracting to its normal position, increasing stopping distances and the risk of a crash. Utilimaster has not provided a remedy plan or a notification schedule. Owners may contact Utilimaster at 1-517-543-6400.

12V-441

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2012

Published October 12, 2012

Mobility Transportation Service (MTS) is recalling certain model year 2006-2011 Paratransit vehicles manufactured from November 2006 through October 2010 that are equipped with Braun Century-2 and/or Vista-2 wheelchair lifts. Over time and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned. A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury. MTS will notify owners, and the repairs will be performed by authorized Braun dealers free of charge. The safety recall began on September 27, 2012. Owners may contact Mobility Transportation Service at 1-734-453-6452. Mobility Transportation Service has named this recall 'Braun01.'

12V-442

C & C Ford is recalling certain model year 2010 through 2011 E-250 and E-350 vehicles equipped with Century-2 and Vista-2 wheelchair lifts installed as aftermarket equipment. Over time and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned. A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall or sustain injury. C & C Ford will notify owners, and the repairs will be performed by authorized Braun dealers free of charge. Owners may contact C & C Ford at 1-270-333-9040.

12V-443

North American Bus Industries (NABI) is recalling certain model year 2010 416 and 40LFW transit buses manufactured from January 1, 2010, through July 31, 2010. The emergency release handles on the emergency egress passenger windows may fail, causing the window release mechanism to operate improperly. In the event of an emergency, the windows may fail to open and passengers may be delayed in exiting, increasing the risk of personal injury. NABI will inspect and replace the window release handles, free of charge. The safety recall is expected to begin during October 2012. Owners may contact NABI at 1-256-831-4296. NABI's recall campaign number is 20124.

12V-444

Triumph is recalling certain model year 2006-2009 Street Triple, Street Triple R, and Daytona 675 motorcycles. The regulator/rectifier can overheat and prevent the motorcycle from charging. Once the battery is fully discharged, the motorcycle may stall. If the motorcycle stalls, there is an increased risk of a crash leading to personal injury. Triumph will notify owners, and dealers will inspect and replace the regulator/rectifier, free of charge. The safety recall is expected to begin on, or before October 12, 2012. Owners may contact Triumph customer service department at 1-678-854-2010.

12V-445

Tracker Marine is recalling certain model year 2010-2013 Mako 18 LTS boat and trailer packages consisting of Mako LTS boats and 2009-2012 EZ Loader-brand AB 18-20 trailers, manufactured from January 8, 2009, through June 6, 2011. The trailers may not have sufficient load carrying capacity to carry the boats which they were intended to transport. Thus, the trailers may be overloaded and fail to comply with the requirements of Part 567, "Certification." Trailer overloading may cause axle or tire failure, increasing the risk of a crash. Tracker

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2012

Published October 12, 2012

Marine will notify owners, and dealers will remedy the trailers, free of charge. The remedy will depend on the particular boat and trailer combination, but may include replacement of axle assemblies, installation of brakes and/or replacement of wheels and tires. The safety recall began on October 4, 2012. Owners may contact Tracker Marine at 1-417-873-4588.

12V-446

Daimler Buses North America (DBNA) is recalling certain model year 2004-2008 Orion V and model year 2005-2006 Orion VII transit buses equipped with John Deere Compressed Natural Gas (CNG) turbocharged engines. The turbine or compressor wheel may fail, resulting in subsequent damage to the engine and/or an oil leak. Failure of the turbine or compressor wheel may result in smoke, fire, and stalling, increasing the risk of a crash. DBNA will notify owners. The remedy for this issue is still under development. The safety recall began on September 28, 2012. Owners may contact Daimler Buses North America at 1-800-882-8054.

12V-447

Autocar Industries, LLC (Autocar) is recalling certain model year 2012 Xpert medium-duty class 7 vehicles, manufactured from October 17, 2011, through June 18, 2012, equipped with both left hand and right hand driving positions. The negative cable ground stud and/or wiring harness on each vehicle may interfere with the right-hand drivers side brake pedal. The interference may prevent the driver from being able to fully depress the brake pedal, resulting in reduced braking capability. A reduction or complete loss of braking capability can lead to increased stopping distances and/or the increased risk of a crash. All of the affected vehicles were corrected by September 28, 2012. Owners may contact Autocar at 1-765-489-5499. Autocar's recall number is M-1203.

12V-448

Mobility Services, Inc., (Mobility Services) is recalling certain model year 2006-2010 Ford E-150, E-250, and E-350 vehicles equipped with Century-2 and/or Vista-2 wheelchair lifts. Over time and with frequent use, the roll stop latches on the outer barrier may become bent or misaligned. A wheelchair occupant may defeat or ride over the insufficiently latched roll stop. If this occurs when the lift platform is in an elevated position, the wheelchair's occupant could fall and sustain injury. Mobility Services will notify owners, and the repairs will be performed by authorized Braun dealers free of charge. The recall is expected to begin during October 2012. Owners may contact Mobility Services at 1-718-267-2921.

12V-449

Prevost is recalling certain model year 2009-2013 Volvo Bus 9700 coaches. The pipe that carries hydraulic fluid to the fan drive may crack allowing oil to spray on hot engine components. Hydraulic oil sprayed onto hot engine components may result in a vehicle fire. Prevost will notify owners, and dealers will add a rubber skirt to the hydraulic pipe, free of charge. The safety recall is expected to begin during October 2012. Owners may contact Prevost at 1-418-883-2888. The Prevost recall campaign number is SR12-64.

12V-450

Jayco, Inc., (Jayco) is recalling certain model year 2008-2009 and 2011 Greyhawk Class C motorhomes, model year 2008-2011 Melbourne Class C motorhomes, and 2008-2010 Octane Sport Utility travel trailers

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2012

Published October 12, 2012

manufactured from May 21, 2007, through September 10, 2010, equipped with Iota-brand transfer switches. These trailers may have an improper electrical connection at the buss bar on the affected transfer switches. This improper connection may lead to overheating and melting of the transfer switch. Overheating and melting of the transfer switch increases the risk of a fire. Jayco will notify owners, and dealers will replace the transfer switch, free of charge. The recall began on October 10, 2012. Owners may contact Jayco at 1-800-283-8267.

12V-451

Geo. Heiser Body Company, Inc., (Geo. Heiser Body Company) is recalling certain model year 2006 International and 2010-2013 Fuso, Hino, International, Kenworth, and Peterbilt vehicles equipped with Sure Power battery separator devices. These devices may overheat. Overheating of the battery separator can result in smoke and possible fire. Geo. Heiser Body Company will notify owners and will replace the battery separators free of charge. The safety recall is expected to begin during October 2012. Owners may contact Geo. Heiser Body Company at 1-206-622-7985.

12V-452

Winnebago is recalling a model year 2013 Winnebago and 2013 Itasca motor home built on a Ford F-53 chassis. The steering gear bracket may have been secured with nuts that may damage the bolts due to an incompatibility between the installation torque and the nut finish. The bolts may fracture, leading to separation of the steering gear and thus a loss of vehicle control, increasing the risk of a crash. These vehicles have been repaired prior to being sold, therefore an owner notification notice will not be issued. Consumers may contact Winnebago Industries Owner Relations at 1-641-585-6939.

12V-453

General Motors LLC (GM) is recalling certain model year 2013 Chevrolet Sonic vehicles manufactured from May 29, 2011, through August 29, 2012. When a turn signal lamp fails to operate, the Body Control Module (BCM) in these vehicles does not detect this condition and will not indicate the condition to the driver. Thus, These vehicles fail to conform to Federal Motor Vehicle Safety Standard No. 108, "Lamps, Reflective Devices, and Associated Equipment." If the driver is not aware that the turn signal is not functioning and does not have the light repaired, other drivers may not be alerted that the vehicle is turning, increasing the risk of a crash. GM will notify owners, and dealers will reprogram the BCM and the vehicle's key fobs, free of charge. The safety recall began on October 3, 2012. Owners may contact the Chevrolet owner center at 1-866-694-6546. GM's campaign number is 12209.

12V-454

Zero Motorcycles, Inc. (Zero Motorcycles) is recalling certain model year 2012 S and DS motorcycles. These motorcycles are equipped with a motor encoder position signal that may drift over the extended use of the motorcycle. If the signal drifts outside of the given parameters, the motor controller may shut off, resulting in the motorcycle inadvertently losing power. A loss of power could lead to a crash and potential injury or death of the rider. Zero Motorcycles will notify owners, and dealers will reprogram the motorcycle's motor controller free of charge. The safety recall began on September 28, 2012. Owners may contact Zero Motorcycles, Inc. at 1-888-786-9376.

12V-455

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2012

Published October 12, 2012

Altec Industries, Inc. is recalling certain model year 2002-2009 AH75/85/100 and HL125 aerial device vehicles equipped with 16-foot radial outriggers. An improper torque was applied to the outrigger cylinder piston retention system during assembly. As a result, the cylinder could loosen from the rod allowing the outrigger leg to protrude beyond the confines of the chassis when it is in a stowed position. If the cylinder loosens from the rod, the outrigger could strike a person or object, increasing the risk of injury or property damage. Altec will notify owners, and will increase the torque on the piston free of charge. Altec has not provided a notification schedule. Owners may contact Altec Industries at 1-877-462-5832.

12V-456

Polaris is recalling certain model year 2012-2013 Victory motorcycles manufactured from January 3, 2012, through August 15, 2012. A torquing procedure may have been missed on some throttle cable retention nuts. On certain motorcycles, the throttle cable retention nuts for either the pull or push throttle cable may have not been torqued correctly. If the torquing is missed and the retention nuts are loose, the retention nuts closest to the throttle body can become dislodged and interfere with the throttle function, increasing the risk of a crash. Victory will notify owners and dealers will correctly torque the fasteners free of charge. The safety recall is expected to begin on October 12, 2012. Owners may contact Victory Consumer Service Department by calling 1-888-704-5290. Polaris' recall number is V-12-01.

12V-457

Forest River, Inc., (Forest River) is recalling certain model year 2010-2013 Sunseeker 2860, 3120, 3170, Forester 2861, 3121, 3171, and Lexington 283 Class C motorhomes, manufactured from August 18, 2009, through September 12, 2012. The liquid propane gas (LPG) fuel line that supplies fuel to appliances in the slide out, can become damaged. A damaged LPG fuel line can lead to an explosion and/or fire, increasing the risk of injury or death. Forest River will notify owners, and dealers will repair the affected vehicles free of charge. The recall is expected to begin during October 2012. Owners may contact Forest River at 1-574-295-8749.

12V-458

General Motors (GM) is recalling certain model year 2007 Chevrolet Equinox and Pontiac Torrent vehicles originally sold or currently registered in Arizona, California, Nevada, and Texas; model year 2007 Chevrolet Cobalt, Pontiac G5, and Saturn ION vehicles originally sold, or currently registered in, Arizona, California, Florida, Nevada, or Texas; model year 2008 Chevrolet Cobalt and Pontiac G5 vehicles originally sold, or currently registered in, Arizona; and model year 2009 Chevrolet Cobalt and Pontiac G5 vehicles originally sold, or currently registered in, Arkansas, Arizona, California, Nevada, Oklahoma, or Texas. Some of these vehicles have a condition in which the plastic supply or return port on the fuel pump module may crack, which could cause a fuel leak. Fuel leakage in the presence of an ignition source may result in a fire. GM will notify owners, and dealers will replace the fuel pump module, free of charge. The recall is expected to begin on, or about, November 12, 2012. Owners may contact General Motors at 1-800-521-7300. GM's campaign number is 12190.

12V-459

General Motors (GM) is recalling certain model year 2007-2010 Saturn Aura and model year 2008-2010 Chevrolet Malibu and Pontiac G6 vehicles, equipped with a 4-speed automatic transmission. On these vehicles,

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING SEPTEMBER 2012

Published October 12, 2012

the tabs on the transmission shift cable end may fracture and separate. If the tabs were to fracture and separate, the shift lever and the actual position of the transmission gear may not match. The driver would be able to move the shifter to 'PARK' and remove the ignition key, but the transmission gear may not be in 'PARK.' The vehicle may not be able to be restarted and the vehicle could roll away after the driver has exited the vehicle, resulting in a possible crash without prior warning. GM will notify owners, and dealers will install a retainer over the cable end or replace the shift cable as necessary. This service will be performed free of charge. The recall is expected to begin on, or about, November 12, 2012. Owners may contact General Motors at 1-800-521-7300. This is General Motors' safety recall number 12106.

12V-460

Honda is recalling certain model year 2012 NC700XDC and NC700XC motorcycles. Some motorcycles may be equipped with drive chains that contain outer drive plates that were improperly heat-treated, resulting in plate fracture during use. If a plate fractures, the motorcycle can unexpectedly lose propulsion, increasing the risk of a crash. Honda will notify owners, and dealers will inspect and, if necessary, replace the drive chain, free of charge. The safety recall began on October 9, 2012. Owners may contact Honda Customer Service at 1-866-784-1870. Honda's recall campaign number is S54.

12V-461

Nissan is recalling certain model year 2012 Frontier, Pathfinder, and Xterra two-wheel drive vehicles manufactured from June 19, 2012, through July 12, 2012. These vehicles may have been equipped with front wheel hubs that may not meet the design hardness specifications. A wheel hub that was manufactured below hardness specification may wear prematurely and eventually crack. If the vehicle is driven in this condition, the wheel hub may break, possibly resulting in a vehicle crash. Nissan will notify owners, and dealers will replace the left and right side front wheel hub assemblies free of charge. The safety recall is expected to begin during October 2012. Owners may contact Nissan Customer Service at 1-800-647-7261.

12V-462

Vermeer is recalling two model year 2012 and one model year 2013 HG6000TX horizontal grinder trailers, manufactured from July 20, 2012, through August 21, 2012, equipped with a dolly transport option. Due to incorrect machining, the kingpin used with the assembly that converts the tracked grinder into a trailer can experience excessive wear. Wear on the kingpin may result in its failure, which could allow the trailer to separate from the towing vehicle, possibly striking another vehicle, a stationary object, or a bystander, causing property damage and/or personal injury. Vermeer will notify owners, and dealers will replace the kingpin free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact Vermeer at 1-641-628-3141. Vermeer's recall campaign number is IK00-1738.

12V-463

Suzuki is recalling certain model year 2012 Equator two-wheel drive vehicles manufactured from June 19, 2012, through July 12, 2012. These vehicles may have been equipped with front wheel hubs that may not meet the design hardness specifications. A wheel hub that was manufactured below hardness specification may wear prematurely and eventually crack. If the vehicle is driven with a cracked wheel hub, the wheel hub may break, which would reduce the driver's ability to control the vehicle, possibly resulting in a vehicle crash. All of the

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2012

Published October 12, 2012

affected vehicles have been quarantined at Suzuki dealers prior to being sold. As such, a recall notification letter will not be issued. Suzuki dealers will replace the left and right side front wheel hub assemblies free of charge. Customers may contact Suzuki at 1-877-697-8985. This is Suzuki recall campaign NY.

12V-464

Navistar is recalling certain model year 2013 International 8600, 2012 and 2013 Durastar, 2011-2013 ProStar, and 2012 WorkStar trucks, manufactured from November 23, 2010, through April 02, 2012, and equipped with piston spring brake feature code 04EVP. The piston bore area of the parking brake chamber may have an air leak could result in the parking brake not fully releasing. If the parking brake does not fully release, the service brakes may lock up without warning, increasing the risk of a crash. Navistar will notify owners, and dealers will replace the spring brake chamber free of charge. The safety recall is expected to begin on, or before, November 12, 2012. Owners may contact Navistar at 1-331-332-1590. Navistar's recall campaign number is 12524.

12V-465

New Flyer is recalling certain model year 2005-2006 C40LF and 2006 C40LFR transit buses, equipped with John Deere 8.1 liter turbocharged, compressed natural gas engines, model number 6081HFN04, manufactured from June 2002 through January 2008. Failures can occur within the engine turbocharger. The turbine or compressor wheel may fail, resulting in damage to the engine and/or an oil leak. Failure of the turbine or compressor wheel may result in smoke, fire, or stalling; possibly leading to a vehicle crash. The remedy for this issue is still under development. An interim letter was mailed on October 3, 2012. Owners may contact New Flyer at 1-204-224-1251. New Flyer's recall campaign number is R12-025.

12V-466

Newmar is recalling certain model year 2008-2010 Dutch Star and 2009-2010 Dutch Aire motorhomes, built on a Spartan chassis equipped with a Hendrickson independent front suspension. The front brake chambers may contact the upper control arm of the independent front suspension. Continued contact may result in damage sufficient enough to prevent the full release of the brakes. If the brakes do not fully release, as they drag, heat could be generated causing the brakes to engage even further. As the brakes heat up, they may self-engage, causing the driver to lose control of the vehicle, increasing the risk of a crash. Spartan Motors will notify owners and repair the vehicles. The manufacturer has not provided a notification schedule. Owners may contact Newmar Corporation at 1-574-773-7791.

12V-467

The Vehicle Production Group (VPG) is recalling certain model year 2011 and 2012 MV-1 vehicles, equipped with a compressed natural gas (CNG) engine. The pressure relief plug for the CNG storage tank may be incorrectly assembled. If the plug is incorrectly assembled, it may inadvertently discharge the CNG. A CNG leak in the presence of an ignition source may ignite and result in a vehicle fire. The Vehicle Production Group will notify owners, and dealers will install a secondary pressure relief device on each vehicle to prevent leaking, free of charge. The manufacturer has not yet provided a notification schedule. Owners may contact the Vehicle Production Group at 1-877-681-3678.

12V-468

SAFETY DEFECT/NONCOMPLIANCE NOTICES

RECEIVED DURING SEPTEMBER 2012

Published October 12, 2012

Eldorado National-California (Eldorado) is recalling certain model year 2006-2008 vehicles equipped with John Deere Compressed Natural Gas (CNG) turbocharged engines. The turbine or compressor wheel may fail, resulting in subsequent damage to the engine and/or an oil leak. Failure of the turbine or compressor wheel may result in smoke, fire, and stalling, increasing the risk of a crash. Eldorado will notify owners and dealers. The remedy for this issue is still under development. Eldorado has not provided a notification schedule. Owners may contact Eldorado National at 905-591-9557 or Thor Industries at 937-596-7965.

12V-469

Heartland Recreational Vehicles, LLC, (Heartland) is recalling certain model year 2012-2013 Bighorn Silverado Fifth Wheel Travel trailers, manufactured from February 28, 2012, through August 28, 2012. The liquid propane (LP) hose and wire hanger that is mounted under the slide out can come in contact with the tire, causing damage to the LP hose and wiring. A damaged LP hose can lead to an LP leak and fire, increasing the risk of injury or death. Heartland will notify owners, and dealers will repair the affected vehicles free of charge. The recall is expected to begin during October 2012. Owners may contact Heartland Recreational Vehicles at 1-888-262-5992. Heartland's number for this recall is 99-01-10.

12V-470

Starcraft RV (Starcraft) is recalling certain model year 2012 and 2013 AR-One travel trailers that may have an inaccurate load carrying capacity label. Due to the inaccurate label, these vehicles fail to comply with the requirements of Federal Motor Vehicle Safety Standard No. 110, "Tire Selection and Rims." An inaccurate label may lead to the tire being replaced with one of an incorrect rim diameter. Two different diameter tires would reduce the handling ability of the trailer, increasing the risk of a crash. Starcraft will notify owners and will provide a corrected label free of charge. The safety recall is expected to begin during October 2012. Owners may contact Starcraft RV at 1-800-945-4787.

12V-471

Autocar, LLC (Autocar) is recalling certain model year 2010-2013 Xpeditor heavy-duty class 8 vehicles, manufactured from September 10, 2010, through September 10, 2012, equipped with a vehicle rearward rollaway alarm. The motion sensor for the alarm may not have been installed correctly and the alarm may fail to sound when the vehicle is out of gear and in a rearward rollaway situation. Without an audible warning that the vehicle is in a rearward rollaway situation, there is an increased risk that the vehicle may hit a pedestrian or another vehicle. Autocar will notify owners, and dealers will repair the affected vehicles, free of charge. The safety recall is expected to begin on November 9, 2012. Owners may contact Autocar, LLC, at 1-765-489-5499.

12V-472

Navistar is recalling certain model year 2006 through 2010 IC transit buses, models 3300, 3200IM, CECB, FCCB, FECB, HCCB, RCCB, and RECB, manufactured from March 16, 2005, through February 24, 2009, equipped with I-6 engines within feature codes 12N (PL, PM, PN, PR, PS, PT, PU, PV, SA, SG, SK, SL, SM, SV, SZ, TB, UA, UB, UC, and UD). The high pressure engine oil line may develop a leak or possibly

SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2012

Published October 12, 2012

rupture. A leak or rupture of the high pressure engine oil line could possibly result in an unexpected engine shut down or may result in an engine compartment fire. Navistar will notify owners, and dealers will replace the high pressure oil line free of charge. The safety recall is expected to begin on, or before, November 25, 2012. Owners may contact Navistar at 1-331-332-1590. Navistar's recall campaign number is 12525.

12V-473

Chrysler is recalling certain model year 2009-2010, Ram 1500 and Dodge Dakota trucks, manufactured from July 1, 2009, through November 30, 2009, because a rear axle pinion nut may loosen due to a lack of adhesive. If the rear axle pinion nut loosens, the axle can lock up and cause a loss of vehicle control and/or a vehicle crash with little warning. Chrysler will notify owners, and dealers will install a pinion nut retainer, free of charge. The recall is expected to begin during November 2012. Owners may contact Chrysler at 1-800-247-9753. Chrysler's recall campaign number is M34.

12V-474

BMW is recalling certain model year 2013 M5, M6 Coupe, and M6 Convertible vehicles, manufactured from July 19, 2012, through September 11, 2012. Due to a manufacturing process error, the tolerance between the engine oil pump's drive shaft and the pump's rotor was not within specification. As a result, the pump's driveshaft could separate from the rotor. Separation of the pump's driveshaft from the rotor could lead to a sudden loss of oil pressure causing the possibility of complete engine failure, resulting in an engine stall-like condition, increasing the risk of a vehicle crash. BMW will notify owners, and dealers will replace the oil pump, free of charge. The safety recall is expected to begin during October 2012. Owners may contact BMW at 1-800-525-7417.

12V-475

Navistar is recalling certain model year 2006 through 2011 IC school buses, models CESB, RESB, and FESB, manufactured from June 17, 2004, through October 15, 2009, equipped with I-6 engines within feature codes 12N (PL, PM, PN, PR, PS, PT, PU, PV, SA, SG, SK, SL, SM, SV, SZ, TB, UA, UB, UC, and UD). The high pressure engine oil line may develop a leak or possibly rupture. A leak or rupture of the high pressure oil line could possibly result in an unexpected engine stall or may result in an engine compartment fire. Navistar will notify owners, and dealers will replace the high pressure oil line free of charge. The safety recall is expected to begin on, or before, November 12, 2012. Owners may contact Navistar at 1-331-332-1590. Navistar's recall campaign number is 12523.

12V-476

Morgan Olson is recalling certain model year 2009 through 2011 walk-in trucks due to failure to conform to various Federal Motor Vehicle Safety Standards (FMVSS). These vehicles may fail to comply with one or more of the following: FMVSS No. 101, "Controls and Displays;" FMVSS No. 103, "Windshield Defrosting and Defogging Systems;" FMVSS No. 104, "Windshield Wiping and Washing Systems;" FMVSS No. 108, "Lamps, Reflective Devices, and Associated Equipment;" FMVSS No. 206, "Door Locks and Door Retention Components;" and 49 CFR Part 567 "Certification." Failure of the vehicles to meet one or more required safety standards may increase the risk of a crash or personal injury. The only owner of the affected vehicles has been notified and Morgan Olson is working with the owner to bring the vehicles into compliance. Therefore, a owner notification letter will not be issued for this campaign. Any repairs will be made free of charge.

**SAFETY DEFECT/NONCOMPLIANCE NOTICES
RECEIVED DURING SEPTEMBER 2012**

Published October 12, 2012

12V-482